



Dimensional Documentation

viega

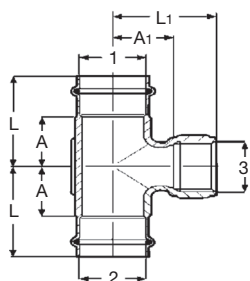


Viega ProPress Tee Zero Lead Bronze P x P x FPT - Model 2917.2ZL

Part No.	Size	A (in)	A1 (in)	L (in)	L1 (in)
	1 2 3				
79580	1/2" x 1/2" x 1/2" FPT	0.79	0.69	1.61	1.30
79585	3/4" x 3/4" x 1/4" FPT	0.67	0.79	1.58	1.18
79590	3/4" x 3/4" x 1/2" FPT	0.79	0.88	1.69	1.42
79595	3/4" x 3/4" x 3/4" FPT	0.91	0.59	1.81	1.14
79760	1" x 1" x 1/2" FPT	0.79	1.04	1.69	1.58
79765	1" x 1" x 3/4" FPT	0.91	1.06	1.81	1.61
79770	1 1/4" x 1 1/4" x 1/2" FPT	0.83	1.16	1.85	1.69
79775	1 1/4" x 1 1/4" x 3/4" FPT	0.95	1.18	1.97	1.73
79780	1 1/2" x 1 1/2" x 1/2" FPT	0.87	1.24	2.28	1.77
79785	1 1/2" x 1 1/2" x 3/4" FPT	0.95	1.30	2.36	1.85
79790	2" x 2" x 1/2" FPT	0.98	1.59	2.56	2.13
79795	2" x 2" x 3/4" FPT	1.06	1.65	2.64	2.21

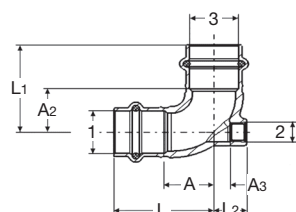


Viega ProPress Tee Vent Zero Lead Bronze P x FPT x P - Model 2917.3ZL

Part No.	Size	A (in)	A2 (in)	A3 (in)	L (in)	L1 (in)	L2 (in)
	1 2 3						
79635	1/2" x 1/8" FPT x 1/2"	0.67	0.67	0.44	1.50	1.50	0.71
79640	3/4" x 1/8" FPT x 3/4"	0.83	0.83	0.54	1.73	1.73	0.81

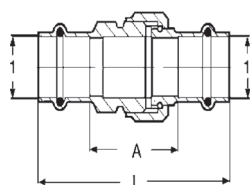

Viega ProPress Union Zero Lead Bronze P x P - Model 2960ZL

Part No.	Size	A (in)	L (in)
	1		
79125	1/2"	1.19	2.84
79130	3/4"	1.34	3.15
79135	1"	1.83	3.64
79140	1 1/4"	1.63	3.68
79145	1 1/2"	2.13	4.96
79150	2"	2.07	5.22

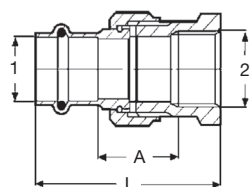

Viega ProPress Union Zero Lead Bronze P x FPT - Model 2962ZL

Part No.	Size	A (in)	L (in)
	1 2		
79700	1/2" x 1/2" FPT	0.91	2.27
79705	3/4" x 3/4" FPT	0.96	2.42
79710	1" x 1" FPT	1.30	2.87
79715	1 1/4" x 1 1/4" FPT	1.27	2.97
79720	1 1/2" x 1 1/2" FPT	1.76	3.86
79725	2" x 2" FPT	1.65	3.92