




Zurn PEX® XL-Low Lead Brass Barb x Female Sweat - QQ__GX Specification Sheet

Tag _____

Dimensional Data: Inches and [mm] are subject to manufacturing tolerances and change without notice.

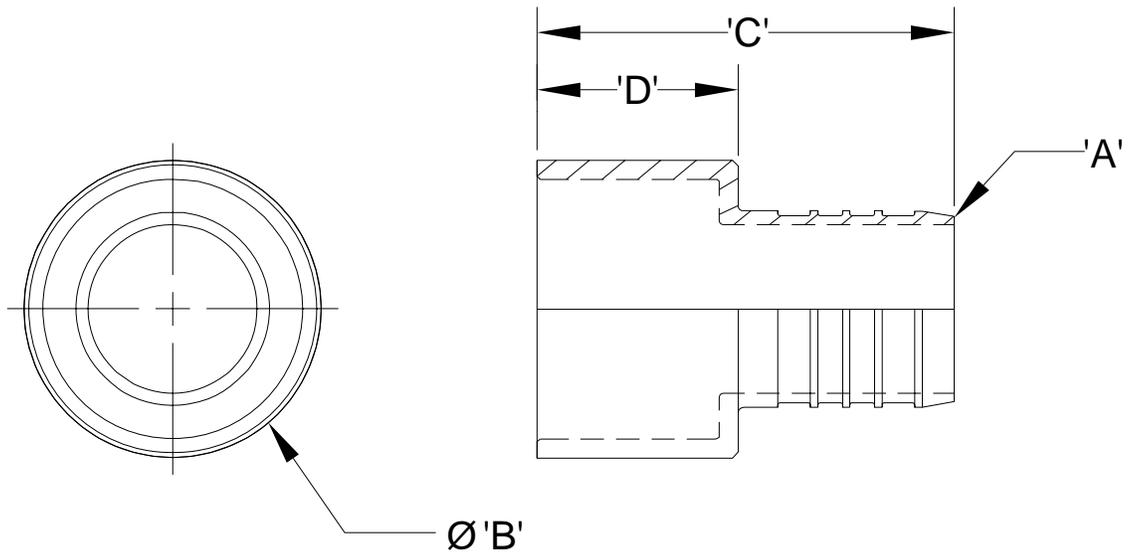

NOTE: Barb geometry will vary depending upon barb size.

Part Number	Description	'A'	'B'	'C'	'D'
QQ812GX	1-1/4" Female Sweat x 1-1/4" PEX Barb	1-1/4" Barb	1.58" [40.1]	2.22" [55.9]	1.07" [27.2]
QQ950GX	1-1/2" Female Sweat x 1-1/2" PEX Barb	1-1/2" Barb	1.87" [47.5]	2.37" [68.2]	1.22" [31.0]
QQ1050GX	2" Female Sweat x 2" PEX Barb	2" Barb	2.37" [60.2]	2.97" [75.4]	1.47" [37.3]

Engineering Specification: Zurn PEX® XL-Low Lead Brass Barb x Female Sweat Adapter. The QQ__GX adapter solders directly to copper tubing. Manufactured from EcoBrass®, C69300. These fittings, as a system with Zurn PEX® tube, are pressure rated at 160 PSI at 73°F, 100 PSI at 180°F, and 80 PSI at 200°F. These fittings are listed by NSF as complying with the following standards: NSF/ANSI Standard 14, NSF/ANSI Standard 61 including Annex G, ASTM F877, CSA B137.5, and ASTM F1807.

Accessories

- ___ **QCR6X** 1-1/4" Copper Crimp Ring
- ___ **QCR7X** 1-1/2" Copper Crimp Ring
- ___ **QCR8X** 2" Copper Crimp Ring

Rev.	Date: 2/22/10	C.N. No. 110726
Dwg. No. 84480	Prod. No. QQ__GX	